



Operating manual

Pyranometer LPPYRA03



Companies / Brands of GHM

Members of GHM GROUP:

GREISINGER
HONSBERG
Martens
IMTRON
/Selta@=IMI
VAL.CO

Keep for future reference.



TABLE OF CONTENTS

1	INTRODUCTION				
2	WORKING PRINCIPLE4				
3	INSTALLATION				
4	ELE	CTRICAL CONNECTIONS	8		
	4.1	LPPYRA03 connections	8		
	4.2	LPPYRA03AC connections	9		
	4.3	LPPYRA03AV connections	9		
	4.4	LPPYRA03S connections	10		
	4.5	LPPYRA03S12 connections	11		
5	MEA	ASUREMENT IN THE MODELS WITH ANALOG OUTPUT	. 12		
	5.1	LPPYRA03	12		
	5.2	LPPYRA03AC	12		
	5.3	LPPYRA03AV	12		
6	RS4	85 MODBUS-RTU OUTPUT	. 13		
	6.1	SETTING THE COMMUNICATION PARAMETERS	. 13		
	6.2	READING THE MEASURES WITH THE MODBUS-RTU PROTOCOL	. 15		
7	SDI	-12 OUTPUT	. 16		
8	MAI	NTENANCE	. 20		
9	TEC	HNICAL SPECIFICATIONS	. 21		
10	SAFETY INSTRUCTIONS22				
11	ORDERING CODES				



1 INTRODUCTION

LPPYRA03 pyranometer measures the irradiance on a flat surface (W/m²). The measured irradiance (Global Irradiance) is the sum of direct solar irradiance and diffuse irradiance.

LPPYRA03 is a Second Class pyranometer in accordance with ISO 9060 and with the criteria of the WMO "Guide to Meteorological Instruments and Methods of Observation", seventh edition (2008).

The pyranometer is available in the following versions:

• LPPYRAO3: PASSIVE

The passive version can be connected to the instruments

D09847 and HD31 by using VP 472 SICRAM module.

• LPPYRAO3AC: ACTIVE with 4..20 mA CURRENT output

• LPPYRAO3AV: ACTIVE with 0..1 or 0..5 or 0..10 V VOLTAGE output to be de-

fined when ordering.

• LPPYRAO3S: With RS485 Modbus-RTU output.

• LPPYRA03S12: With SDI-12 output.

The pyranometer is supplied factory calibrated and with a calibration report. The calibration is carried out in accordance with the ISO 9847:1992 (type IIc) standard: "Calibration of field pyranometers by comparison to a reference pyranometer". The pyranometer is calibrated by comparison with the reference sample calibrated annually at WRC (World Radiation Center).



2 WORKING PRINCIPLE

LPPYRAO3 pyranometer is based on a thermopile sensor. The thermopile sensitive surface is coated with a black matt paint, which allows the pyranometer not to be selective at different wavelengths. The pyranometer spectral range is determined by the transmission of the glass dome type K5.

Radiant energy is absorbed by the thermopile black surface, thus creating a difference of temperature between the center of the thermopile (hot junction) and the pyranometer body (cold junction). Thanks to the Seebeck effect, the difference of temperature between hot and cold junction is converted into a Difference of Potential.

In order to grant the thermopile a proper thermal insulation from the wind and reduce the sensitivity to thermal irradiance, LPPYRAO3 is equipped with a 4 mm thick dome which is 32 mm in outer diameter. The dome protects the thermopile from the dust, which might change spectral sensitivity if it lies on the black surface,

To prevent internal condensation forming on the internal side of the dome under certain climatic conditions, silica gel tablets are inserted inside the pyranometer to absorb humidity.

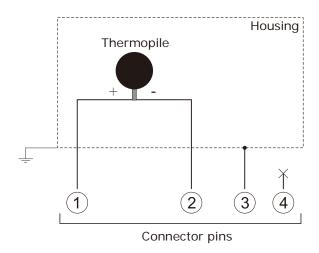


Fig. 2.1: scheme of principle LPPYRA03 (version with mV output)



3 INSTALLATION

- The pyranometer must be mounted in an easy-to-reach location in order to clean the dome regularly and carry out maintenance. At the same time, make sure that no buildings, constructions, trees or obstructions exceed the horizontal plane where the pyranometer lies. If this is not possible, select a site where obstructions in the path of the sun from sunrise to sunset do not exceed 5 degrees of elevation. N.B.: The presence of obstructions on the horizon line affects significantly the measurement of direct irradiance.
- The pyranometer must be located far from any kind of obstruction, which might reflect sunlight (or sun shadow) onto the pyranometer itself.
- In compliance with ISO TR9901 standard and WMO recommendations, when the pyranometer is used without the white shade disk, it must be positioned so that its connector is pointed to the North Pole, if the instrument is used in the Northern Hemisphere, and to the South Pole, if used in the Southern Hemisphere. In any case, it is better to follow this suggestion even when the shade disk is applied.
- For fixing, use the holes on the pyranometer body or the suitable accessories (see the figures below). In order to allow an accurate horizontal positioning, the pyranometer is equipped with a levelling device. The mast height does not exceed the pyranometer plane to avoid measurement errors caused by any reflection or shadow of the mast itself.
- It is preferably to thermally insulate the pyranometer from its mounting bracket ensuring, at the same time, a good electrical contact to ground.

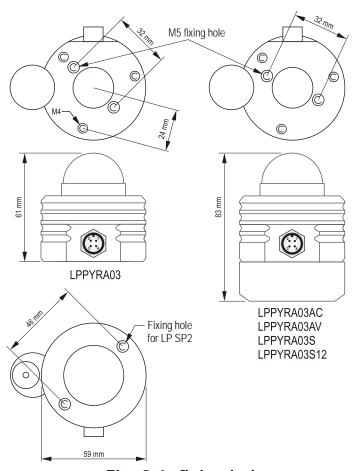


Fig. 3.1: fixing holes



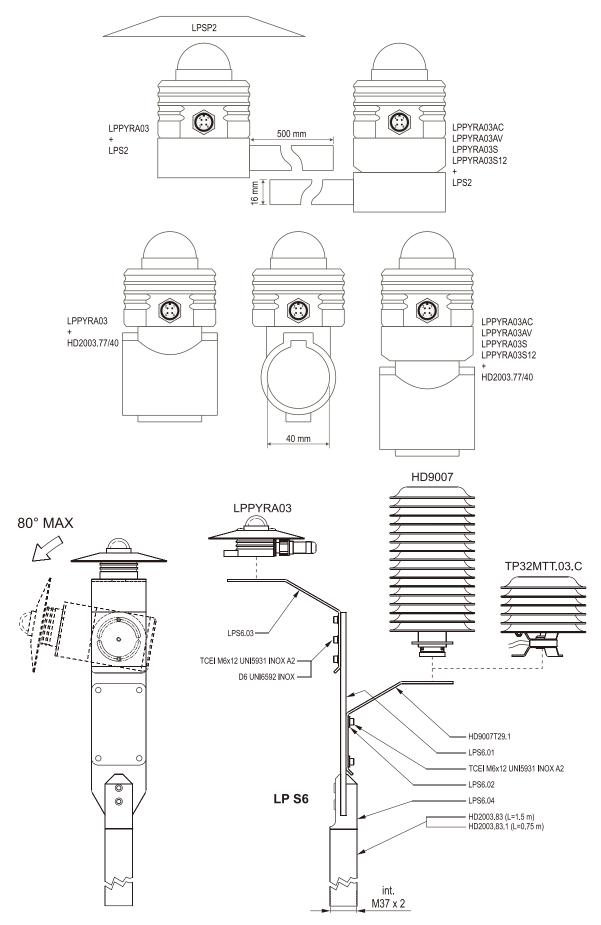


Fig. 3.2: fixing accessories



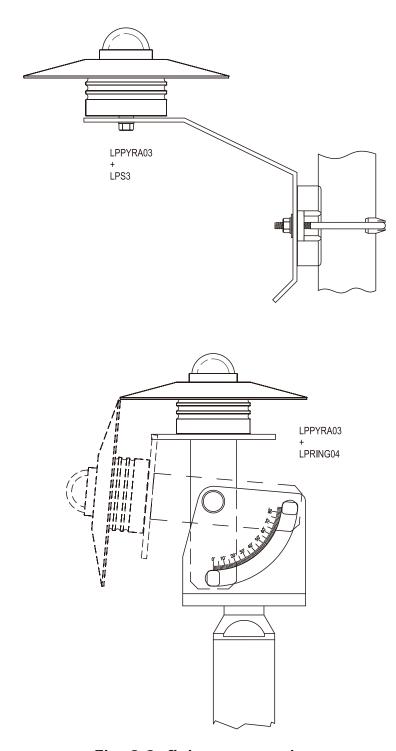


Fig. 3.3: fixing accessories



4 ELECTRICAL CONNECTIONS

LPPYRAO3AC and **LPPYRAO3AV** have a 4-pole connector and use the **CPM12AA4... optional** cables in UV resistant PTFE, with 4-pole connector on one side and open wires on the other side.

LPPYRA03S and **LPPYRA03S12** have a 8-pole connector and use the **CPM12-8D... optional** cables in UV resistant PTFE, with 8-pole connector on one side and open wires on the other side.



The metallic housing of the pyranometer should preferably be grounded $(\frac{1}{2})$ locally. In this case, do not connect the wire of the cable corresponding to the housing to prevent ground loops.

Only if it is not possible to ground locally the metallic case of the pyranometer, connect the wire of the cable corresponding to the housing to ground $(\frac{1}{+})$.

The wire of the cable corresponding to the housing depends on the model: white wire in LPPYRAO3 and LPPYRAO3AC, black wire (cable shield) in LPPYRAO3S and LPPYRAO3S12. In LPPYRAO3AV the housing is not connected directly to the connector.

4.1 LPPYRA03 CONNECTIONS

The pyranometer LPPYRAO3 is passive and does not require power supply. It is to be connected either to a millivoltmeter or to a data acquisition system. Typically, the pyranometer output signal does not exceed 20 mV. In order to better exploit the pyranometer features, the readout instrument should have 1 μ V resolution.

Connector	Function	Color
1	Vout (+)	Red
2	Vout (-)	Blue
3	Housing	White
4	Cable shield	Black

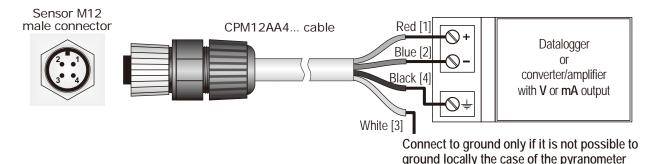



Fig. 4.1: LPPYRA03 connections



4.2 LPPYRA03AC CONNECTIONS

The pyranometer LPPYRAO3AC has **4...20 mA** output and requires **10...30 Vdc** external power supply. It is to be connected to a power supply and an instrument with 4...20 mA input as shown in fig. 4.2. The load resistance of the instrument reading the signal must be \leq **500 \Omega**.

Connector	Function	Color
1	Positive (lin)	Red
2	Negative (Iout)	Blue
3	Housing	White
4	Cable shield	Black

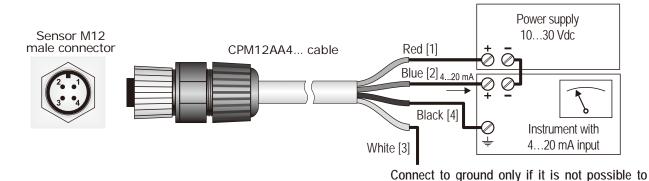

ground locally the case of the pyranometer Fig. 4.2: LPPYRAO3AC connections

4.3 LPPYRAO3AV CONNECTIONS

The pyranometer LPPYRA03AV has 0...1 V, 0...5 V or 0...10 V output (depending on the ordered output) and requires external power supply: 10...30 Vdc for 0...1 V and 0...5 V outputs, 15...30 Vdc for 0...10 V output. It is to be connected to a power supply and an instrument with voltage input as shown in fig. 4.3. The load resistance of the instrument reading the signal must be $\geq 100 \text{ k}\Omega$.

Connector	Function	Color
1	Output positive (+Vout)	Red
2	Output negative (-Vout) Power supply negative (GND)	Blue
3	Power supply positive (+Vdc)	White
4	Cable shield	Black

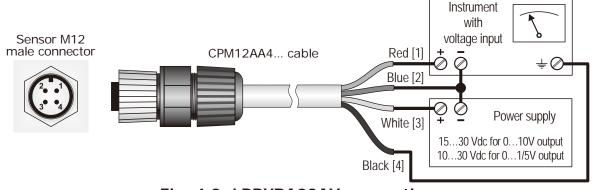


Fig. 4.3: LPPYRA03AV connections



4.4 LPPYRAO3S CONNECTIONS

The pyranometer LPPYRAO3S has **RS485 Modbus-RTU** output and requires **5...30 Vdc** external power supply. It is to be connected to a power supply and to a PLC, a data logger or a RS485/USB or RS485/RS232 converter for PC as shown in fig. 4.4. The RS485 output is not isolated.

Connector	Function	Color
1	Power supply negative (GND)	Blue
2	Power supply positive (+Vdc)	Red
3	Not connected	
4	RS485 A/-	Brown
5	RS485 B/+	White
6	Housing	Shield (Black)
7	Not connected	
8	Not connected	

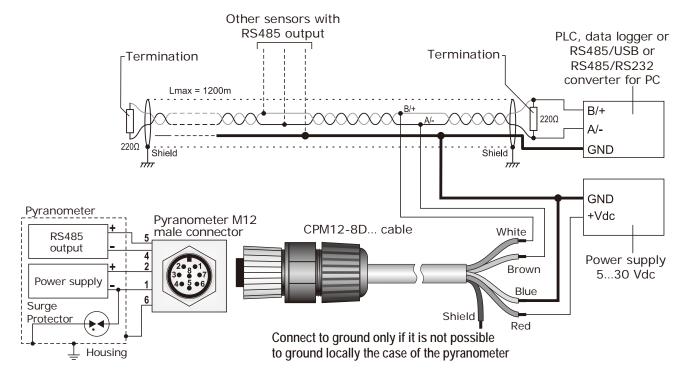


Fig. 4.4: LPPYRA03S connections

Before connecting the pyranometer to the RS485 network, set the address and the communication parameters, if different from the factory preset (see chapter 6).



4.5 LPPYRA03S12 CONNECTIONS

The pyranometer LPPYRA03S12 has **SDI-12** output and requires **7...30 Vdc** external power supply. It is to be connected to a power supply and to an acquisition system (data logger) as shown in fig. 4.5.

Connector	Function	Cable color
1	Power supply negative (GND) SDI-12 output negative	Blue
2	Power supply positive (+Vdc)	Red
3	Not connected	
4	Not connected	
5	SDI-12 output positive	White
6	Housing	Shield (Black)
7	Not connected	
8	Not connected	

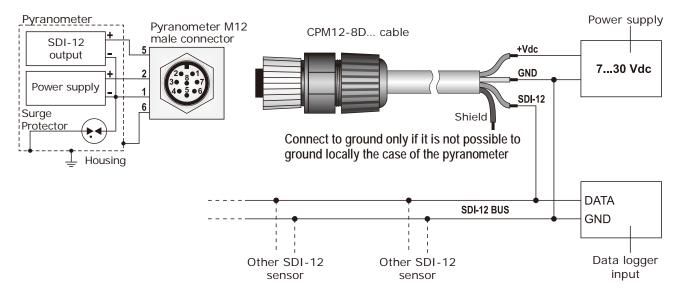


Fig. 4.5: LPPYRA03S12 connections

More SDI-12 sensors can be connected in parallel. The distance between a sensor and the acquisition system (data logger) should not exceed 60 m.

Due to its low power consumption (< $200 \mu A$), LPPYRA03S12 is particularly suitable for battery/solar panel-powered data acquisition systems.

Before connecting the instrument to an SDI-12 network containing other sensors, set the address by using the proper SDI-12 command (see chapter 7).



5 MEASUREMENT IN THE MODELS WITH ANALOG OUTPUT

Below are the ways to calculate the global irradiance in the models with analog output LPPYRAO3, LPPYRAO3AC and LPPYRAO3AV.

5.1 LPPYRA03

Each pyranometer is distinguished by its own sensitivity (or calibration factor) $\bf S$ expressed in $\mu V/(Wm^{-2})$ and shown in the label on the pyranometer (and in the calibration report).

The irradiance E_e is obtained by measuring with a multimeter the difference of potential **DDP** at the ends of the sensor and applying the following formula:

$$E_e = DDP / S$$

where:

 E_e is the irradiance expressed in W/m²;

DDP is the difference of potential expressed in μV measured by the multimeter;

S is the sensitivity of the pyranometer expressed in $\mu V/(Wm^{-2})$.

5.2 LPPYRA03AC

The 4...20 mA output signal corresponds to the 0...2000 W/m² irradiance range.

The irradiance E_e is obtained by measuring with a multimeter the current I_{out} absorbed by the sensor and applying the following formula:

$$E_e = 125 \cdot (I_{out} - 4)$$

where:

 E_e is the irradiance expressed in W/m²;

I_{out} is the current expressed in mA absorbed by the pyranometer.

5.3 LPPYRAO3AV

The output signal (0...1 V, 0...5 V or 0...10 V depending on the version) corresponds to the 0...2000 W/m^2 irradiance range.

The irradiance E_e is obtained by measuring with a multimeter the output voltage V_{out} of the sensor and applying the following formula:

 $E_e = 2000 \cdot V_{out}$ for the version 0...1 V

 $E_e = 400 \cdot V_{out}$ for the version 0...5 V

 $E_e = 200 \cdot V_{out}$ for the version 0...10 V

where:

 E_e is the irradiance expressed in W/m²;

 V_{out} is the output voltage expressed in V measured by the multimeter.



 
6 RS485 MODBUS-RTU OUTPUT

Before connecting the pyranometer to the RS485 network, an address must be assigned and the communication parameters must be set, if different from the factory preset.


6.1 SETTING THE COMMUNICATION PARAMETERS

Connect the pyranometer to the PC in one of the following two ways:

A. By using the optional **CP24** cable, with built-in RS485/USB converter. In this connection mode, the sensor is powered by the PC USB port. To use the cable, it is necessary to install the related USB drivers in the PC.



B. By using the supplied 8-pole M12 female connector or the optional **CPM12-8D...** cable and a generic RS485/USB or RS485/RS232 converter. In this connection mode, it is necessary to power the pyranometer separately. If a RS485/USB converter is used, it is necessary to install the related USB drivers in the PC.

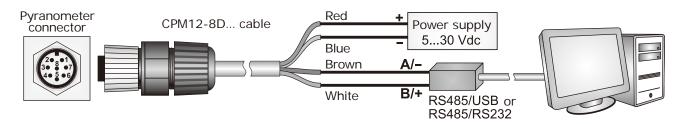

Notes on the Installation of Unsigned USB driver: before installing unsigned USB driver into operating systems starting from Windows 7, it is necessary to restart the PC by disabling the driver signing request. If the operating system is 64-bit, even after installation the request of driver signing have to be disabled each time the PC is restarted.

Procedure:

- 1. Start with the pyranometer not powered (if the CP24 cable is used, disconnect one end of the cable).
- 2. In the PC, start a serial communication program. Set the Baud Rate to 57600 and set the communication parameters as follows (the pyranometer is connected to a COM type port):

Data Bits: 8
Parity: None
Stop Bits: 2

In the program, set the COM port number to which the pyranometer will be connected.

3. Switch the pyranometer on (if the CP24 cable is used, connect both ends of the cable).



- **4.** Wait until the pyranometer transmits the **&** character, then send (within 10 seconds from the pyranometer power on) the **@** command and press **Enter**.
 - *Note*: if the pyranometer does not receive the @ command within 10 seconds from power on, the RS485 MODBUS mode is automatically activated. In such a case, it is necessary to switch off and on again the pyranometer.
- **5.** Send the command **CAL USER ON**.

 Note: the command CAL USER ON is disabled after 5 minutes of inactivity.
- **6.** Send the serial commands given in the following table to set the RS485 MODBUS parameters:

Command	Response	Description		
CMAnnn	&	Set RS485 address to nnn		
		Ranging from 1 to 247		
		Preset on 1		
CMBn	&	Set RS485 Baud Rate		
		$ \begin{array}{l} n=0 \Rightarrow 9600 \\ n=1 \Rightarrow 19200 \end{array} $		
		Preset on 1 ⇒ 19200		
CMPn & Set RS485 transmission mode		Set RS485 transmission mode		
		$n=0 \Rightarrow 8-N-1$ (8 data bits, no parity, 1 stop bit) $n=1 \Rightarrow 8-N-2$ (8 data bits, no parity, 2 stop bits) $n=2 \Rightarrow 8-E-1$ (8 data bits, even parity, 1 stop bit) $n=3 \Rightarrow 8-E-2$ (8 data bits, even parity, 2 stop bits) $n=4 \Rightarrow 8-O-1$ (8 data bits, odd parity, 1 stop bit) $n=5 \Rightarrow 8-O-2$ (8 data bits, odd parity, 2 stop bits) Preset on $2 \Rightarrow 8-E-1$		
CMWn	&	Set receiving mode after RS485 transmission		
		$n=0 \Rightarrow$ Violate protocol and go in Rx mode right after Tx $n=1 \Rightarrow$ Respect protocol and wait 3.5 characters after Tx		
		Preset on 1 ⇒ Respect the protocol		

7. You can check the parameters setting by sending the following serial commands:

Command	Response	Description	
RMA	Address	Read RS485 address	
RMB	Baud Rate	Read RS485 Baud Rate	
	(0,1)	0 ⇒ 9600	
		1 ⇒ 19200	
RMP	Tx Mode	Read RS485 transmission mode	
	(0,1,2,3,4,5)	0 ⇒ 8-N-1	
		1 ⇒ 8-N-2	
$2 \Rightarrow 8-\text{E}-1$		- ' '	
		$ \begin{array}{c} 3 \Rightarrow 8-E-2 \\ 4 \Rightarrow 8-O-1 \end{array} $	
		$5 \Rightarrow 8-0-2$	
RMW	Rx Mode	Read receiving mode after RS485 transmission	
	(0,1)	0 ⇒ Violate protocol and go in Rx mode right after Tx	
	(57.)	1 ⇒ Respect protocol and wait 3.5 characters after Tx	

Note: it is not required to send the CAL USER ON command to read the settings.



6.2 READING THE MEASURES WITH THE MODBUS-RTU PROTOCOL

In MODBUS mode, you can read the values measured by the pyranometer through the function code 04h (Read Input Registers). The following table lists the quantities available with the appropriate register address:

Number	Address	Quantity	Format
3	2	Solar radiation in W/m ²	16-bit Integer
4	3	Status register: bit0=1 ⇒ solar radiation measurement error bit2=1 ⇒ configuration data error bit3=1 ⇒ program memory error	16-bit Integer
5	4	Average values of the last 4 measurements	16-bit Integer
6	5	Signal generated by the sensor in μV/10 [e.g.: 816 means 8160 μV, the resolution is 10 μV]	16-bit Integer

Note: Register address = Register number - 1, as defined in the Modbus standard.

OPERATING MODE: the pyranometer enters RS485 MODBUS-RTU mode after 10 seconds from power on. In the first 10 seconds from power on the pyranometer does not reply to requests from the MODBUS master unit. After 10 seconds, it is possible to send MODBUS requests to the pyranometer.



7 SDI-12 OUTPUT

The LPPYRA03S12 pyranometers are compatible with version 1.3 of SDI-12 protocol.

The protocol communication parameters are: Baud rate = 1200. Data bits = 7, Parity = Even, Stop bits = 1.

The communication with the instrument is performed by sending a command in the following form:

<Address><Command>!

with <Address> = address of the instrument the command is sent to <Command> = type of operation requested to the instrument

The instrument reply is as follows:

<Address><Data><CR><LF>

with <Address> = address of the instrument which replies <Data> = information sent by the instrument

<CR> = ASCII character Carriage Return

<LF> = ASCII character *Line Feed*

The sensors come with a factory address preset to 0. The address can be modified by using the proper SDI-12 command reported in the following table.

The following table reports the SDI-12 commands available. For consistency with SDI-12 standard documentation, the instrument address is indicated in the table with the letter \mathbf{a} .

SDI-12 Commands

Command	Instrument reply	Description
a!	a <cr><lf></lf></cr>	Verifies the presence of the instrument.
al!	allcccccccmmmmmmvvvssssssss <cr><lf> with: a = address of the instrument (1 character) II = SDI-12 compliant version (2 characters) ccccccc = manufacturer (8 characters) mmmmmm = instrument model (6 characters) vvv = firmware version (3 characters) ssssssss = serial number (8 characters) ⇒ Example of response: 013DeltaOhmLP-PYRAO016051518 with: 0 = instrument address 13 = SDI-12 version 1.3 compliant DeltaOhm = manufacturer's name LP-PYR = instrument model A00 = firmware version A.0.0 16051518 = serial number</lf></cr>	Requests for information from the instrument.
aAb!	b <cr><lf></lf></cr>	Modification of the instru-
Where: b =new address	Note: if the b character is not an acceptable address, the instrument responds with a instead of b.	ment address.



Command	Instrument reply	Description
?!	a <cr><lf></lf></cr>	Request of the address of the instrument. If more than one sensor is connected to the bus, a conflict occurs.
Түре М	(START MEASUREMENT) AND TYPE $\sf C$ (START CONCURRENT $\sf N$	EASUREMENT) COMMANDS
Irra	adiance, signal internal level and internal tempera	ture (if available)
aM! aC!	atttn <cr><lf> with: ttt = number of seconds necessary for the instrument to make the measure available (3 characters) n = number of detected variables (1 character for aM!, 2 characters for aC!)</lf></cr>	Request to execute the measurement.
	Note: ttt = 000 means datum immediately available.	
aDO!	a+n+ww+vv+tt < CR> < LF> with: n = content of the status register ww = irradiance in W/m² vv = signal internal level in mV tt = internal temperature in the set unit of measurement (default °C) if the NTC temperature sensor is present, otherwise the fixed value 25 °C ⇒ Example of response: 0+0+228.7+3.294+25.0 probe address = 0 content of the status register = 0 irradiance = 228.7 W/m² signal internal level = 3.294 mV internal temperature or fixed value = 25.0 °C Note: the status register normally contains zero; a value different from zero indicates an error condition.	Reads the measurement.
	Irradiance and internal temperature (if av	ailahle)
aM1!	atttn <cr><lf></lf></cr>	Request to execute the
aC1!	with: ttt = number of seconds necessary for the in- strument to make the measure available (3 characters) n = number of detected variables (1 character for aM1!, 2 characters for aC1!) Note: ttt = 000 means datum immediately available.	measurement.
aDO!	a+ww+tt < CR > < LF > with: ww = irradiance in W/m² tt = internal temperature in the set unit of measurement (default °C) if the NTC temperature sensor is present, otherwise the fixed value 25 °C ⇒ Example of response: 0+228.7+25.0 probe address = 0 irradiance = 228.7 W/m² internal temperature or fixed value = 25.0 °C	Reads the measurement.



Command	Instrument reply	Description
	Internal temperature (if available)	
aM2! aC2!	atttn <cr><lf> with: ttt = number of seconds necessary for the instrument to make the measure available (3 characters) n = number of detected variables (1 character for aM2!, 2 characters for aC2!) Note: ttt = 000 means datum immediately available.</lf></cr>	Request to execute the measurement.
aD0!	a+tt <cr><lf> with tt = internal temperature in the set unit of measurement (default °C) if the NTC temperature sensor is present, otherwise the fixed value 25 °C ⇒ Example of response: 0+25.0 probe address = 0 internal temperature or fixed value = 25.0 °C</lf></cr>	Reads the measurement.
	Signal internal level	
aM3! aC3!	atttn <cr><lf> with: ttt = number of seconds necessary for the instrument to make the measure available (3 characters) n = number of detected variables (1 character for aM3!, 2 characters for aC3!) Note: ttt = 000 means datum immediately available.</lf></cr>	Request to execute the measurement.
aD0!	a+vv <cr><lf> with vv = signal internal level in mV ⇒ Example of response: 0+3.294 probe address = 0 signal internal level = 3.294 mV</lf></cr>	Reads the measurement.

In addition to the above-mentioned commands, the sensor also implements the corresponding commands with CRC, that require to add a 3-character CRC code at the end of the reply before <CR><LF>. The format of these commands is obtained from the previous by adding the letter C: aMC!, aMC1!, aMC2!, aMC3!, aCC!, aCC1!, aCC2!, aCC3!. The sensor **does not** implement the type R (Continuous Measurements) commands.

Extended SDI-12 Commands

Command	Instrument reply	Description
aXSCAL USER ON!	a> USER ENABLED! <cr><lf></lf></cr>	Enables the configuration mode.
aXSCFD!	a> & <cr><lf></lf></cr>	Sets °C as temperature unit of measurement.
aXSCFE!	a> & <cr><lf></lf></cr>	Sets °F as temperature unit of measurement.
aXSCAL END!	a> LOCKED! < CR > < LF >	Disables the configuration mode.



The extended commands allow setting the temperature unit of measurement (if the temperature sensor is present). To change the unit of measurement:

- 1) Send the command **aXSCAL USER ON!** (note: **a**=instrument address).
- 2) Send the command aXSCFD! (to set °C) or aXSCFE! (to set °F).
- 3) Send the command aXSCAL END!

For more information about the SDI-12 protocol, visit the website "www.sdi-12.org".



8 MAINTENANCE

In order to grant measurements high accuracy, it is important to keep the outer glass dome clean. Consequently, the more the dome will be kept clean, the more measurements will be accurate.

You can wash it using water and standard papers for lens. If necessary, use pure ETHYL alcohol. After using alcohol, clean again the dome with water only.

To exploit all the pyranometer features, it is highly recommended that the calibration be checked annually.



9 TECHNICAL SPECIFICATIONS

Sensor	Thermopile
Typical sensitivity	5÷15 μV/Wm-²
Impedance	33÷45 Ω
Measuring range	0÷2000 W/m²
Viewing angle	2π sr
Spectral range (50%)	300÷2800 nm
Operating temperature/humidity	-40÷80 °C / 0÷100%
Output	Analog in µV/Wm-2 (LP PYRAO3) Analog 4÷20 mA (LPPYRAO3AC) Analog 0÷1 V, 0÷5 V or 0÷10 V (LPPYRAO3AV) Digital RS485 Modbus-RTU (LPPYRAO3S) Digital SDI-12 (LPPYRAO3S12)
Power supply	10÷30 Vdc (LPPYRA03AC and LPPYRA03AV with 0÷1 V and 0÷5 V output) 15÷30 Vdc (LPPYRA03AV with 0÷10 V output) 5÷30 Vdc (LPPYRA03S) 7÷30 Vdc (LPPYRA03S12)
Consumption	< 200 µA for the version LPPYRA03S12
Connection	4-pole M12 connector (LPPYRA03, LPPYRA03AC and LPPYRA03AV) 8-pole M12 connector (LPPYRA03S and LPPY-RA03S12)
Dimensions	Fig. 3.1
Weight	0.45 kg
Accuracy of levelling device	< 0.2°
Protection degree	IP 67
MTBF	> 10 years

Technical Specifications According to ISO 9060

	1
Response time (95%)	< 30 s
Zero offset	
a) response to a 200 W/m ² thermal radiation	< 25 W/m ²
b) response to a 5 K/h change in ambiente temperature	< ±6 W/m²
Long-term instability (1 year)	< ±2.5 %
Non-linearity	< ±2 %
Response according to the cosine law	< ±22 W/m²
Spectral selectivity	< ± 7 %
Temperature response (-10+40°C)	< 8 %
Tilt response	< ±4 %



10 SAFETY INSTRUCTIONS

General safety instructions

The instrument has been manufactured and tested in accordance with the safety standard EN61010-1:2010 "Safety requirements for electrical equipment for measurement, control and laboratory use" and has left the factory in perfect safety technical conditions.

The instrument proper operation and operating safety can be ensured only if all standard safety measures as well as the specific measures described in this manual are followed.

The instrument proper operation and operating safety can be ensured only in the climatic conditions specified in this manual.

Do not use the instruments in places where there are:

- Corrosive or flammable gases.
- Direct vibrations or shocks to the instrument.
- High-intensity electromagnetic fields, static electricity.

User obligations

The instrument operator shall follow the directives and regulations below that refer to the treatment of dangerous materials:

- EEC directives on workplace safety.
- National law regulations on workplace safety.
- Accident prevention regulations.



11 ORDERING CODES		
LPPYRA03	Second class pyranometer according to ISO 9060. Complete with levelling device, M12 4-pole connector and Calibration Report. LPSP2 shade disk and CPM12AA4 cable have to be ordered separately.	
LPPYRA03AC	Second class pyranometer according to ISO 9060. Complete with levelling device, M12 4-pole connector and Calibration Report. Output 420 mA. Power supply 1030 Vdc. LPSP2 shade disk and CPM12AA4 cable have to be ordered separately.	
LPPYRA03AV	Second class pyranometer according to ISO 9060. Complete with levelling device, M12 4-pole connector and Calibration Report. Output 01 Vdc, 05 Vdc or 010 Vdc (to be defined when ordering). Power supply 1030 Vdc for the versions with output 01 Vdc and 05 Vdc, 1530 Vdc for the version with output 010 Vdc. LPSP2 shade disk and CPM12AA4 cable have to be ordered separately.	
LPPYRA03S	Second class pyranometer according to ISO 9060. Complete with levelling device, M12 8-pole connector and Calibration Report. RS485 Modbus-RTU output. Power supply 530 Vdc. LPSP2 shade disk and CPM12-8D cable have to be ordered separately.	
LPPYRA03S12	Second class pyranometer according to ISO 9060. Complete with levelling device, M12 8-pole connector and Calibration Report. SDI-12 output. Power supply 730 Vdc. LPSP2 shade disk and CPM12-8D cable have to be ordered separately.	
LPSP2	Shade disk.	
LPS2	Kit including a fixing base for the pyranometer and a \varnothing 16 x 500 mm rod.	
LPS3		
	Fixing bracket for the pyranometer, suitable for \varnothing 40 \div 50 mm mast. Installation on horizontal or vertical mast.	
LPRING04	0 13	
LPRING04 HD2003.79K	mast. Installation on horizontal or vertical mast. Adjustable holder for mounting the pyranometer in an inclined	
	mast. Installation on horizontal or vertical mast. Adjustable holder for mounting the pyranometer in an inclined position on Ø 40 mm mast with internal thread. Kit to mount the pyranometer on Ø40 mm clamping. To install	
HD2003.79K	mast. Installation on horizontal or vertical mast. Adjustable holder for mounting the pyranometer in an inclined position on Ø 40 mm mast with internal thread. Kit to mount the pyranometer on Ø40 mm clamping. To install the pyranometer on a transverse mast. Kit for the installation of the pyranometer, including: 750 mm mast (HD2003.83.1), base fitting (LPS6.04), graduated support	
HD2003.79K LPS6	mast. Installation on horizontal or vertical mast. Adjustable holder for mounting the pyranometer in an inclined position on Ø 40 mm mast with internal thread. Kit to mount the pyranometer on Ø40 mm clamping. To install the pyranometer on a transverse mast. Kit for the installation of the pyranometer, including: 750 mm mast (HD2003.83.1), base fitting (LPS6.04), graduated support plate (LPS6.01), bracket for pyranometers (LPS6.03). Cable with 4-pole M12 connector on one end, open wires on the	
HD2003.79K LPS6 CPM12AA4.2	mast. Installation on horizontal or vertical mast. Adjustable holder for mounting the pyranometer in an inclined position on Ø 40 mm mast with internal thread. Kit to mount the pyranometer on Ø40 mm clamping. To install the pyranometer on a transverse mast. Kit for the installation of the pyranometer, including: 750 mm mast (HD2003.83.1), base fitting (LPS6.04), graduated support plate (LPS6.01), bracket for pyranometers (LPS6.03). Cable with 4-pole M12 connector on one end, open wires on the other end. Length 2 m. Cable with 4-pole M12 connector on one end, open wires on the	



CPM12-8D.5 Cable with 8-pole M12 connector on one end, open wires on the

other end. Length 5 m.

CPM12-8D.10 Cable with 8-pole M12 connector on one end, open wires on the

other end. Length 10 m.

CP24 PC connecting cable for the RS485 MODBUS parameters configu-

ration of the LPPYRA...S pyranometers. With built-in RS485/USB converter. 8-pole M12 connector on instrument side and A-type

USB connector on PC side.

LPRING13 Ring base for measuring the diffused radiation.

DELTA OHM metrology laboratories LAT N $^\circ$ 124 are ISO/IEC 17025 accredited by ACCREDIA for Temperature, Humidity, Pressure, Photometry / Radiometry, Acoustics and Air Velocity. They can supply calibration certificates for the accredited quantities.





CE

DICHIARAZIONE DI CONFORMITÀ UE EU DECLARATION OF CONFORMITY

Delta Ohm S.r.L. a socio unico – Via Marconi 5 – 35030 Caselle di Selvazzano – Padova – ITALY

Documento Nr. / Mese.Anno: Document-No. / Month. Year: 5082 / 10.2017

Si dichiara con la presente, in qualità di produttore e sotto la propria responsabilità esclusiva, che i seguenti prodotti sono conformi ai requisiti di protezione definiti nelle direttive del Consiglio Europeo:

We declare as manufacturer herewith under our sole responsibility that the following products are in compliance with the protection requirements defined in the European Council directives:

Codice prodotto: LPPYRA03 – LPPYRA03AC – LPPYRA03AV

Product identifier: LPPYRA03S - LPPYRA03S12

Descrizione prodotto:
Product description:
Product description:
Pyranometer

I prodotti sono conformi alle seguenti Direttive Europee: The products conform to following European Directives:

Direttive / Directives		
2014/30/EU	Direttiva EMC / EMC Directive	
2014/35/EU	Direttiva bassa tensione / Low Voltage Directive	
2011/65/EU	RoHS / RoHS	

Norme armonizzate applicate o riferimento a specifiche tecniche: Applied harmonized standards or mentioned technical specifications:

Norme armonizzate / Harm	onized standards
EN 61010-1:2010	Requisiti di sicurezza elettrica / Electrical safety requirements
EN 61326-1:2013	Requisiti EMC / EMC requirements
EN 50581:2012	RoHS / RoHS

Il produttore è responsabile per la dichiarazione rilasciata da: The manufacturer is responsible for the declaration released by:

Johannes Overhues

Amministratore delegato Chief Executive Officer

Caselle di Selvazzano, 30/10/2017

Questa dichiarazione certifica l'accordo con la legislazione armonizzata menzionata, non costituisce tuttavia garanzia delle caratteristiche.

Chauna Deline

This declaration certifies the agreement with the harmonization legislation mentioned, contained however no warranty of characteristics.

JD Auspice Co., Ltd. TEL: 886-2-8991-2796 FAX: 886-2-8991-9298 service@jdauspice.com www.jdauspice.com





GUARANTEE

TERMS OF GUARANTEE

All DELTA OHM instruments are subject to accurate testing, and are guaranteed for 24 months from the date of purchase. DELTA OHM will repair or replace free of charge the parts that, within the warranty period, shall be deemed non efficient according to its own judgement. Complete replacement is excluded and no damage claims are accepted. The DELTA OHM guarantee only covers instrument repair. The guarantee is void in case of incidental breakage during transport, negligence, misuse, connection to a different voltage than that required for the appliance by the operator. Finally, a product repaired or tampered by unauthorized third parties is excluded from the guarantee. The instrument shall be returned FREE OF SHIPMENT CHARGES to your dealer. The jurisdiction of Padua applies in any dispute.



The electrical and electronic equipment marked with this symbol cannot be disposed of in public landfills. According to the Directive 2011/65/EU, the european users of electrical and electronic equipment can return it to the dealer or manufacturer upon purchase of a new one. The illegal disposal of electrical and electronic equipment is punished with an administrative fine.

This guarantee must be sent together with the instrument to our service centre. IMPORTANT: Guarantee is valid only if coupon has been correctly filled in all details.

Instrument Code:	LPPYRA03	
Serial Number		
RENEWALS		
Date	Date	
Inspector	Inspector	
Date	Date	
Inspector	Inspector	
Date	Date	
Inspector	Inspector	
CE		

